

Technical Bulletin T-30714 (Mar 7, 2014)

Model : Linkbox 8000HD Local/ 8000HD Plus

Problem : No menu/No picture, Wrong LED display. ERom upgrade does not work, etc

Cause of problem: One or two inductor (4R7) among 4 that are located on the left front side of main PCB board was damaged. Damage was done by factory assembly machine.

How to check problem parts : Check the 4R7 inductor's right leg voltage and if it does not meet the standard voltage and is more than 5-10% lower, it means that is damaged. These damaged 4R7 parts will be too hot when touched with the finger. In most cases , we found one or two damaged among four.

How to fix : Remove the damaged parts and replace with a new one.

**** It is recommend to hire a good service technician.

**** We will send the new parts immediately upon request.

**** New hard ware version units S/N start with 1312----- or the main chip heat sink's color is silver compared to the black one does not have this problem.

**** Call 818-768-5494 or e-mail linkboxusa@gmail.com for more question.

